

### SERVICE BULLETIN SB-101722-C

ID NUMBER & REVISION:	SB-1	L0172	2-C				
SUBJECT:	Can	opy La	atch Installa	ation			
RELEASE DATE:	15 C	Decen	nber 2022				
EFFECTIVE DATE:	15 C	Decen	nber 2022				
SUPERSEDES NOTICE:	SB-1	L0172	2-В				
AIRCRAFT AFFECTED:	MA	KE & I	MODEL:	ICON A5			
	SER	IAL N	UMBERS:	ASN: 0013	0 – 00153; (	00155	5; 00156; 00158 – 00166
<b>REQUIRED ACTION:</b>	Insp	ect th	ne canopy	atch mech	anism for p	prope	r torque and installation.
	Adju	ust the	e canopy la	tch mechar	nism if torqu	ue spe	ecifications are not met.
TIME OF COMPLIANCE:	At t	he ne	xt Service li	nterval or if	the canopy	/ latcł	n opens during flight.
<b>REVISION HISTORY:</b>	Α	Initia	l Release				
LEVEL OF CERTIFICATION			Pilot/Own	er		$\boxtimes$	A & P
<b>REQUIRED</b> (any level check	ked		LSA Repair	man – Insp	ection	$\boxtimes$	Certified Repair Station

can perform task):

#### **PURPOSE:**

ICON has identified a situation where the canopy latch mechanism would not remain closed during flight. In addition, the canopy latch mechanism could be opened with less than the required amount of force per ICON specifications. The intent of this service bulletin (SB-101722-C) is to provide guidance for the inspection of the canopy latch and adjustment to the canopy latch mechanism.

 $\ge$ 

LSA Repairman – Maintenance 🛛 Manufacturer

#### **ASSEMBLIES AND PARTS:**

PART NUMBER	DESCRIPTION		ALTERNATE		
PART NUIVIDER	DESCRIPTION	DESCRIPTION QUANTITY PART NUM		DESCRIPTION	
N/A	Powder Free Nitrile Gloves	A/R			
N/A	Powder Free Latex Gloves	A/R			
N/A	Isopropyl Alcohol	A/R			
MS16624-4075	Retaining Ring	1 (As			
		Needed)			
ICA014544	Wave Spring	1 (As			
		Needed)			
ITL002660	Torque Wrench Adapter	1			
SIL-POXY	SIL Poxy	A/R			
LOCTITE 243	Loctite 243	A/R			



### SERVICE BULLETIN SB-101722-C

#### IF APPLICABLE, SERVICE KITS:

<b>KIT NUMBER</b>	CONTENT PARTS	DESCRIPTION	QUANTITY
N/A			

#### **INSTRUCTIONS:**

It is permissible to disassemble the aircraft as required to permit accessibility, inspection, adjustment, maintenance, and repair in accordance with the latest release of the ICON Aircraft Maintenance Manual.

It is also permissible to retain and reuse any serviceable parts and hardware.

#### Latch Strike Plate Inspection/Repair

- 1. Lift the canopy up and out of the way
- 2. Loosen the two bolts on the back of the strike plate
  - a. See Figure 1

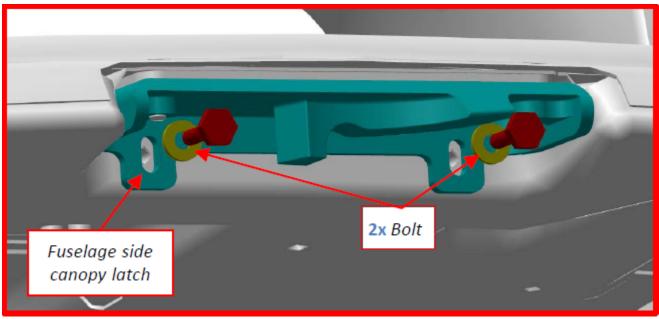


Figure 1 Bolts and Back of Strike Plate

- 3. Inspect the two screws on top of the strike plate
  - a. Verify the two screws are torqued to 26 in-lb
  - b. See Figure 2

**NOTE**: If SIL-POXY is present it will be reapplied as the final step of canopy latch torque adjustments have been made.



# SERVICE BULLETIN SB-101722-C

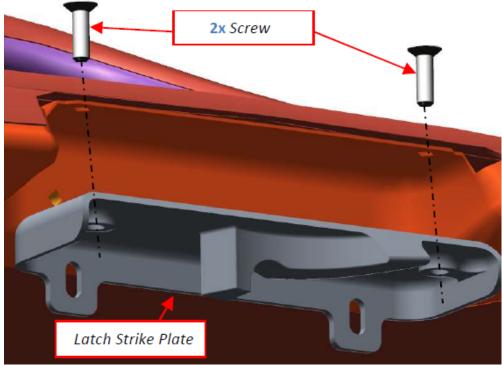


Figure 2 Screws on Top of Strike Plate


4. Torque the two bolts on back of the strike plate to 26 in-lb.

### **Interior Canopy Handle Removal**

- 1. Sitting in the cockpit with canopy closed, remove the interior canopy latch handle by removing the set screw
  - a. See Figure 3



## SERVICE BULLETIN SB-101722-C

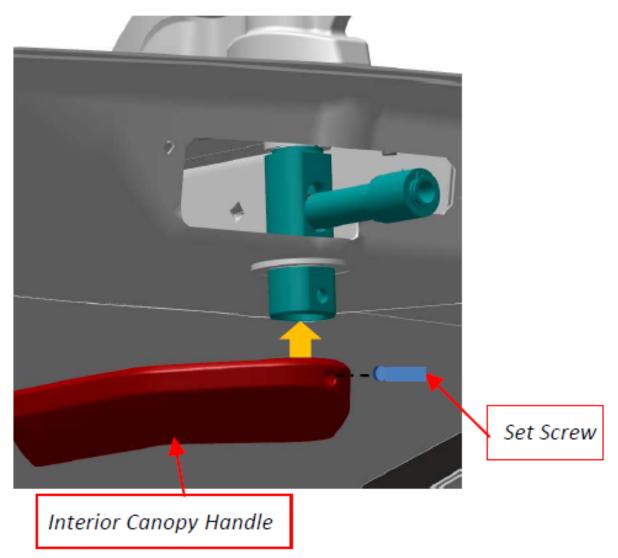



### Snap Ring Inspection/Repair

- 1. While seated in the cockpit, inspect the inside of the canopy latch shaft for proper installation of the retaining ring.
  - a. See Figure 4
- 2. Ensure the retaining ring is seated in the inner groove of the latch shaft
  - a. See Figure 5



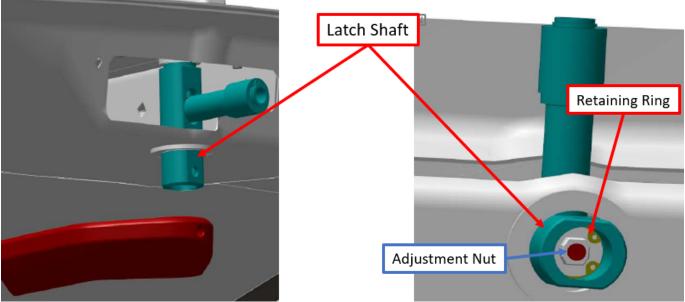


Figure 4 Latch Shaft and Retaining Ring



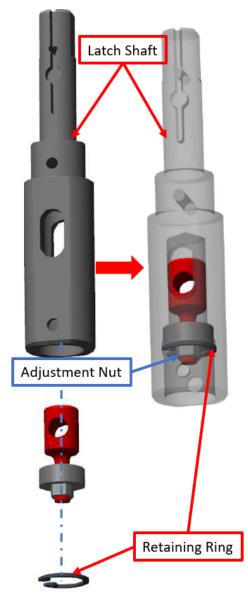


Figure 5 Canopy Latch Shaft Retaining Ring

- 3. If the retaining ring is not properly seated into position:
  - a. With needle nose pliers, carefully push the retaining ring back into position by firmly pushing up on the retaining ring until it clicks/ snaps into place.
  - b. If Unable to confidently seat snap ring into place, loosen the striker latch arm to allow smooth up and down adjustments (see Figure 6)



# SERVICE BULLETIN SB-101722-C

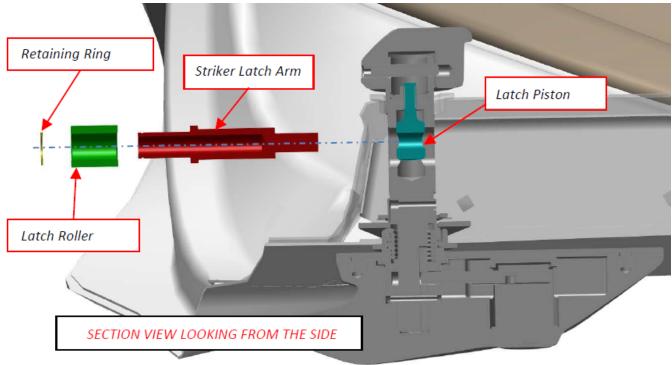


Figure 6 Striker Latch Arm


c. Turn the adjustment nut clockwise/ counterclockwise as to move the latch piston up or down to allow for the snap ring to confidently be seated in the snap ring groove.

### **Canopy Latch Torque Inspection**

- 1. On the canopy latch shaft, use a force gauge or tool ITL002660 adapter and torque wrench (see Figure 8) to check the torque of the canopy latch mechanism.
  - a. 20 to 35 in lb to open canopy
  - b. 25 MAX in lb to close canopy
  - c. See Figure 7



## SERVICE BULLETIN SB-101722-C

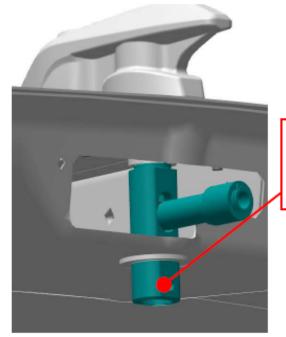

Use a force gauge or a torque wrench with the ITL002660 adapter tool to check for proper torque setting.

Figure 7 Torque Check on Canopy Latch



Figure 8 ITL Torque Tool for Torque Wrench

2. If the torque measurements are not within limits proceed with Canopy Latch Adjustment.

#### **Canopy Latch Adjustment**

- 1. Slightly loosen striker arm to allow for smooth up and down adjustments
- 2. With the canopy closed and canopy latch closed, turn the adjustment nut inside the canopy latch to adjust the torque required to open and closed the canopy latch.
  - a. See Figures 9 and 10



# SERVICE BULLETIN SB-101722-C

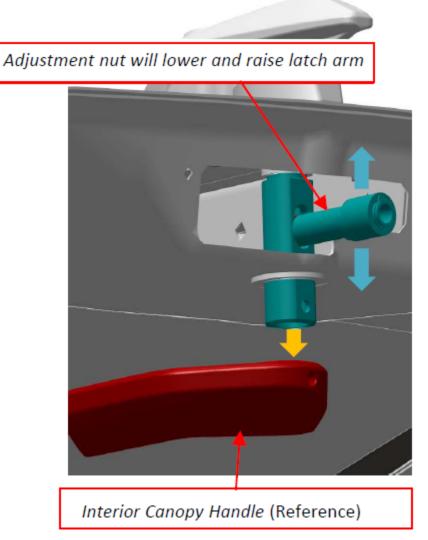


Figure 9 Canopy Latch Adjustment



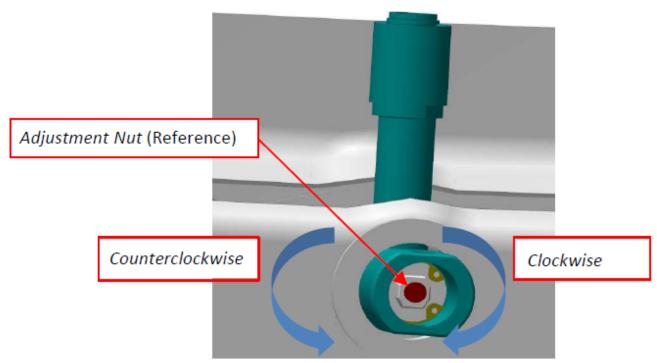


Figure 10 Adjusting the Canopy Latch

- 3. On the canopy latch shaft, use a force gauge or tool ITL002660 adapter and torque wrench (see Figure 8) to check the torque of the canopy latch mechanism.
  - a. 20 to 35 in-lb to open canopy
  - b. Verify that the close force is no more than 25 in-lb to close canopy
  - c. See Figure 11



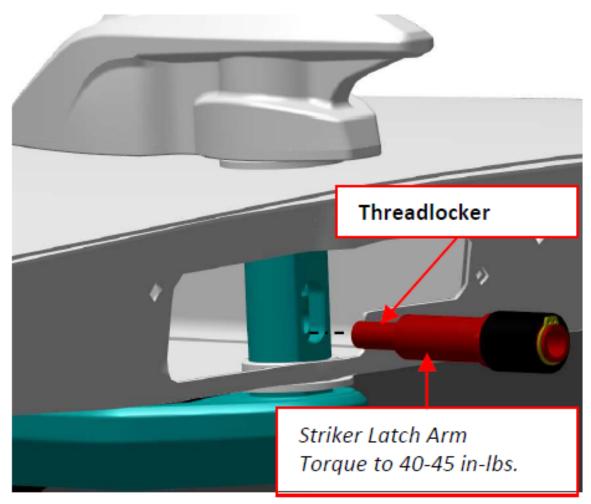


Figure 11 Canopy Torque Adjustment

- 4. Torque Striker Latch Arm to 40-45 in-lb
  - a. See Figure 12



## SERVICE BULLETIN SB-101722-C

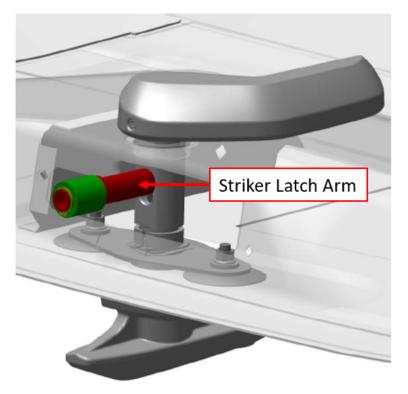


Figure 12 Striker Latch Arm

- 5. Validate the Canopy Latch torque after the latch striker arm is torqued to ensure nothing has changed
- 6. Install the canopy latch handle by inserting the handle over the canopy latch shaft and installing the set screw.
  - a. Apply Loctite 243 to the set screw
  - b. Torque set screw to 2-4 in-lb.
  - c. See Figure 3

**NOTE**: If SIL-POXY is present at the top side of the countersunk screw, re-apply SIL-POXY flush to canopy jam

#### Make the following logbook entry:

"I hereby certify the repair and/or alteration has been completed in accordance with this Service Bulletin and all the referenced documents. Potentially unclear procedures have been clarified with the Aircraft OEM. No issues were observed that might hinder return to service.

The corrective action of Service Bulletin (SB-101722-CC) has been complied with (ref. FAA Exemption 10829B)".



## SERVICE BULLETIN SB-101722-C

If you have questions, comments, or concerns about this Service Bulletin and/or if you are no longer owner/operator of this aircraft, please forward this information to the present owner/operator and notify ICON Aircraft at: ICON Aircraft 2141 ICON Way, Suite 100 Vacaville, CA 95688 (855) FLY-ICON or (707) 564-4000 <u>support@iconaircraft.com</u>

Please include the aircraft registration number, serial number, your name, and if known the contact information of the new owner/operator.