



2141 ICON Way, Vacaville, CA 95688 - Tel: 707.564.4000 – www.iconaircraft.com

NOTIFICATION

N-120715 REV A

DATE ISSUED: 12/7/15
DATE EFFECTIVE: 12/7/15
SUPERSEDES NOTICE: None
SUBJECT: Exhaust Header Fracture
AIRCRAFT AFFECTED: **MODEL:** A5
S/N: 00001, 00002
REQUIRED ACTION: Inspect Exhaust headers for fractures
TIME OF COMPLIANCE: Before next flight

PURPOSE: Some owners are experiencing partial or complete fracture of the exhaust header at the location of the exhaust gas temperature sensors weldment. The purpose of this notification is to provide instructions to inspect this weldment to check for fractures.

ICON Aircraft, Inc. is continuing to investigate the cause of the fractures. Once determined, ICON will communicate the cause and provide any additional instructions or replacement parts as deemed necessary.

PARTS LIST:

PART	DESCRIPTION	A5
ICA008971	FWD LH SIDE EXHAUST HEADER WELDMENT	(1)
ICA008968	FWD RH SIDE EXHAUST HEADER WELDMENT	(1)
ICA008970	AFT LH SIDE EXHAUST HEADER WELDMENT	(1)
ICA008967	AFT RH SIDE EXHAUST HEADER WELDMENT	(1)

INSTRUCTIONS:

1. After each flight, remove engine cowling per Maintenance Manual Chapter 3.4.2, steps 1 through 7, and inspect FWD and AFT exhaust headers for fractures.
2. If no fractures are observed reinstall engine cowling and repeat inspection after next flight.
3. If fractures are found please contact ICON Aircraft, Owners Center prior to continuing flight operations.

If you are no longer in possession of this aircraft, please forward this information to the present owner/operator and notify ICON Aircraft, Owners Center at:

ICON Aircraft
2141 ICON Way
Vacaville, CA 95688
(855) FLY-ICON or (707) 564-4000
support@iconaircraft.com

Please include the aircraft registration number, serial number, your name, and if known the contact information of the new owner/operator.