



2141 ICON Way, Vacaville, CA 95688 - Tel: 707.564.4000 – www.iconaircraft.com

SERVICE BULLETIN

SB-032417 REV A

DATE ISSUED: 3/24/2017
DATE EFFECTIVE: 3/24/2017
SUPERSEDES NOTICE: None
SUBJECT: Engine mount crack inspection
AIRCRAFT AFFECTED: **MODEL:** ICON A5
S/N: 00001, 00003 – 00019

REQUIRED ACTION:

TIME OF COMPLIANCE: During next major service (100 hour inspection) if aircraft has less than 100 hours total time and service. Within next 10 hours of operation if aircraft is between 100 and 300 hours of total time and service. Before next flight if aircraft is over 300 hours of total time and service.

PURPOSE:

It was discovered during a major service interval that the engine mount on ASN-1 had a crack in the weld that separated the forward support strut. The crack was located on the upper pilot's side where the mount attaches to the engine.

ICON Aircraft is mandating the inspection of the engine mount based on the before mentioned criteria.

WARRANTY:

N/A

PARTS LIST:

PART	DESCRIPTION	A5
None		

INSTRUCTIONS:

1. Remove engine cowling per ICON maintenance manual chapter 3.4.2.
2. Use a flashlight and mechanic's mirror to inspect all welded joints on engine mount for signs of cracking.

If any anomalies are discovered discontinue flight operations and report to ICON Aircraft customer support.

MAKE THE FOLLOWING LOGBOOK ENTRY:



2141 ICON Way, Vacaville, CA 95688 - Tel: 707.564.4000 – www.iconaircraft.com

SERVICE BULLETIN

SB-032417 REV A

“Service Bulletin SB-032417 Rev A. has been complied with and reported to ICON Aircraft Owner Support”.

If you are no longer in possession of this aircraft, please forward this information to the present owner/operator and notify ICON Aircraft, Owners Center at:

ICON Aircraft
2141 ICON Way
Vacaville, CA 95688
(855) FLY-ICON or (707) 564-4000
ownersupport@iconaircraft.com

Please include the aircraft registration number, serial number, your name, and if known the contact information of the new owner/operator.